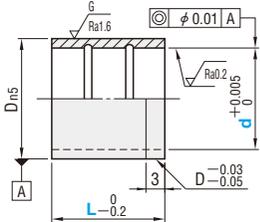
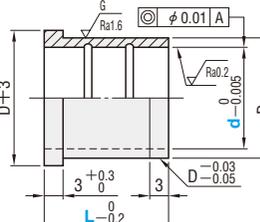
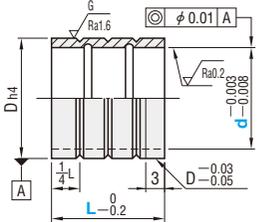
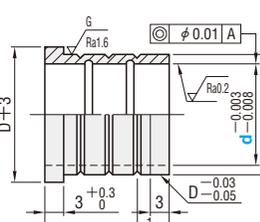


ストリッパガイドブシュ

—給油・無給油タイプ—

☉ストリッパガイドブシュは常温環境(40℃以下)にてご使用ください。☉取付方法 P.1069

■給油タイプ

	<p>SGBA(圧入タイプ)</p>  <p>材質 SUJ2 硬度 58HRC~</p>
	<p>SGBH(圧入タイプ)</p>  <p>材質 SUJ2 硬度 58HRC~</p>
	<p>SGBL(ロックタイト接着タイプ)</p>  <p>材質 SUJ2 硬度 58HRC~</p>
	<p>SGBT(ロックタイト接着タイプ)</p>  <p>*外径溝数: L ≤ 20 → 2本 L > 20 → 3本</p> <p>材質 SUJ2 硬度 58HRC~</p>

D _{n5}	型式		L					
	Type	d						
12	SGBA	8	10	13	16	20		
14		+0.020 +0.012	10	10	13	16	20	25
18		13	13	16	20	25		
22		+0.024 +0.015	16		16	20	25	30
25		20			20	25	30	
32		+0.028 +0.017	25				25	30 35

D _{m5}	型式		L						
	Type	d							
12	SGBH	8	10	13	16	20			
14		+0.015 +0.007	10	10	13	16	20	22 25	
18		13	13	16	20	22	25	30 35	
22		+0.017 +0.008	16	13	16	20	22	25	30 35
25		20		16	20	22	25	30 35	
32		+0.020 +0.009	25				20	22 25 30 35	

D _{n4}	型式		L						
	Type	d							
12	SGBL	8	10	13	16	20			
14		⁰ _{-0.005}	10	10	13	16	20	22 25	
18		13	13	16	20	22	25	30 35	
22		⁰ _{-0.006}	16	13	16	20	22	25	30 35
25		20		16	20	22	25	30 35	
32		⁰ _{-0.007}	25				20	22 25 30 35	

D _{n4}	型式		L						
	Type	d							
12	SGBT	8	10	13	16	20			
14		⁰ _{-0.005}	10	10	13	16	20	22 25	
18		13	13	16	20	22	25	30 35	
22		⁰ _{-0.006}	16	13	16	20	22	25	30 35
25		20		16	20	22	25	30 35	
32		⁰ _{-0.007}	25				20	22 25 30 35	